PERMABOND® ET5390



Two-Part Epoxy

Provisional Technical Datasheet

Features & Benefits

- Adhesion to a wide variety of substrates
- Full cure at room temperature
- Easy to apply
- Good impact strength
- Excellent adhesion to stainless steel

Description

PERMABOND® ET5390 is a thixotropic two-part epoxy adhesive with a soft paste consistency. When fully cured, ET5390 exhibits exceptional adhesion to a wide variety of materials including hard-to-bond substrates and stainless steel. It is easy to mix and apply - its controlled flow properties allow it to be used where gap filling is required.

Physical Properties of Uncured Adhesive

	ET5390A	ЕТ5390В
Chemical composition	Epoxy Resin	Polyamide
Appearance	Black paste	Black
Viscosity @ 23°C	2rpm: 250,000-500,000 mPa.s (<i>cP</i>) 20rpm: 85,000- 135,000 mPa.s (<i>cP</i>)	20rpm: 30,000- 50,000 mPa.s <i>(cP)</i>
Specific gravity	1.5	1.3


Typical Curing Properties

Mix ratio	1:1 by volume 100:90 by weight
Maximum gap fill	3 mm <i>0.12 in</i>
Usable / pot life @23°C 10g mixed	1 hour
Working strength @23°C	@ 23°C: 6-12 hours @ 60°C: 1 hour
Full cure @23°C	@ 23°C: 72 hours @ 60°C: 2 hours

Typical Performance of Cured Adhesive

Shear strength (mild steel)* (ISO4587)	Cured 72hrs @23°C: 17-19 N/mm ² (2500-2800 psi) Cured 2 hrs @ 60°C: 20-22 N/mm ² (2900-3200 psi)	
Shear strength (stainless steel)* (ISO4587)	Cured 72 hrs @ 23°C As received: 17-21 N/mm ² (2500-3000 psi) Gritblast/degrease: 19-21 N/mm ² (2800-3000 psi) Cured 2 hrs @ 60°C As received: 18-22 N/mm ² (2600-3200 psi) Gritblast/degrease: 24-26 N/mm ² (3500-3800 psi)	
Hardness (ISO868)	75-80 Shore D	

*Strength results will vary depending on the level of surface preparation and gap.

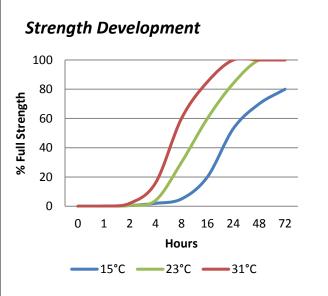


Graph shows typical strength development of bonded components. An increase of 8°C in temperature will halve the cure time. Lower temperatures will result in a slower cure time.

to their needs and to the circumstances prevailing in their business. Nothing contained herein shall be constructed to imply the non-existence of any relevant patents or to constitute a permission, inducement or recommendation to practice any invention covered by any patent, without authority from the owner of this patent. We also expect purchasers to use our products in accordance with the guiding principles of the Chemical Manufacturers Association's Responsible Care® program.

Permabond ET5390

The information given and the recommendations made herein are based on our research and are believed to be accurate but no guarantee of their accuracy is made. In every case we urge and recommend that purchasers before using any product in full-scale production make their own tests to determine to their own satisfaction whether the product is of acceptable quality and is suitable for their particular purpose under their own operating conditions. THE PRODUCTS DISCLOSED HEREIN ARE SOLD WITHOUT ANY WARRANTY AS TO MERCHANTABILITY OR FITNESS FOR A PARTICULAR PURPOSE OR ANY OTHER WARRANTY, EXPRESS OR IMPLIED. No representative of ours has any authority to waive or change the foregoing provisions but, subject to such provisions, our engineers are available to assist purchasers in adapting our products

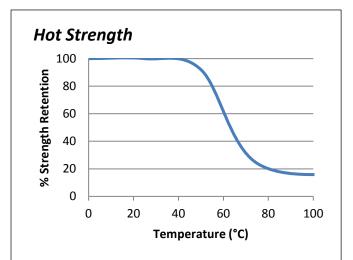

"Hot strength" shear strength tests performed on mild steel. Fully cured specimens conditioned to pull temperature for 30 minutes before testing at temperature.

ET5390 can withstand higher temperatures for brief periods (such as for paint baking and wave soldering processes) providing the joint is not unduly stressed. The minimum temperature the cured adhesive can be exposed to is -40°C (-40°F) depending on the materials being bonded.

Additional Information

This product is not recommended for use in contact with strong oxidizing materials.

Information regarding the safe handling of this material may be obtained from the safety data sheet.

Users are reminded that all materials, whether innocuous or not, should be handled in accordance with the principles of good industrial hygiene.

This Technical Datasheet (TDS) offers guideline information and does not constitute a specification.

Storage & Handling

Storage Temperature

5 to 25°C (41 to 77°F)

Surface Preparation

Surfaces should be clean, dry and grease-free before applying the adhesive. Use a suitable solvent (such as acetone or isopropanol) for the degreasing of surfaces. Some metals such as aluminium, copper and its alloys will benefit from light abrasion with emery cloth (or similar), to remove the oxide layer.

Directions for Use

- Dual cartridges:

 a) Insert the cartridge into the application gun and guide the plunger into the cartridge.
 b) Remove the cartridge cap and dispense material until both sides are flowing.
 c) Attach the static mixer to the end of the cartridge and begin dispensing the material.
- 2. Apply material to one of the substrates.
- 3. Join the parts. Parts must be joined within an hour of mixing the two epoxy components.
- 4. Large quantities and/or higher temperature will decrease the usable life or pot life.
- 5. Apply pressure to the assembly until handling strength is obtained.
- Full cure will be obtained after 72 hours at 23°C (77°F). Heat can be used to accelerate the curing process.

Video Links

Surface preparation: https://youtu.be/8CMOMP7hXjU



Two-part epoxy directions for use: https://youtu.be/GRX1RyknYqc

www.permabond.com

UK: 0800 975 9800
 General Enquiries: +44 (0)1962 711661

 US: 732-868-1372
 Asia: + 86 21 5773 4913
 info.europe@permabond.com
 info.americas@permabond.com
 info.asia@permabond.com

The information given and the recommendations made herein are based on our research and are believed to be accurate but no guarantee of their accuracy is made. In every case we urge and recommend that purchasers before using any product in full-scale production make their own tests to determine to their own satisfaction whether the product is of acceptable quality and is suitable for their particular purpose under their own operating conditions. THE PRODUCTS DISCLOSED HEREIN ARE SOLD WITHOUT ANY WARRANTY AS TO MERCHANTABILITY OR FITNESS FOR A PARTICULAR PURPOSE OR ANY OTHER WARRANTY, EXPRESS OR IMPLIED. No representative of ours has any authority to waive or change the foregoing provisions but, subject to such provisions, our engineers are available to assist purchasers in adapting our products to their needs and to the circumstances prevailing in their business. Nothing contained herein shall be construed to imply the non-existence of any relevant patents or to constitute a permission, inducement or recommendation to practice any invention covered by any patent, without authority from the owner of this patent. We also expect purchasers to use our products in accordance with the guiding principles of the Chemical Manufacturers Association's Responsible Care® program.