Permabon

PERMABOND® TA4660

Toughened Acrylic Adhesive Provisional Technical Datasheet

Features & Benefits

- Excellent adhesion to nylon
- No primers required
- Full cure at room temperature
- Low odour
- Good temperature resistance

Description

PERMABOND® TA4660 is a 2-part, 2:1 low odour, acrylic adhesive. It was developed for structural bonding of nylon/polyamide (filled and unfilled) without the need for any primers or additional surface treatment, such as plasma. TA4660 is also good for bonding nylon in combination with certain metals. It cures at room temperature and contains microbeads to control the bondline thickness for superior performance.

Physical Properties of Uncured Adhesive

	<u> </u>	
	TA4660 A-side	TA4660 B-side
Chemical composition	Acrylic	Acrylic
Colour	Yellow	Black
Mixed colour	Dark green/grey	
Viscosity @ 25°C	100,000 mPa.s <i>(cP)</i> Thixo	100,000 mPa.s <i>(cP)</i> Thixo
Specific gravity	1.0	1.0

Typical Curing Properties


7, 3		
Ratio of use	2:1	
Maximum gap fill (NB: Contains microparticles to control gap)	1 mm (0.04 in)	
Pot life (10g mixed) @23°C	5 minutes	
Fixture time (0.1 N/mm² shear strength is achieved) @23°C	25 minutes	
Handling time (0.3 N/mm² shear strength is achieved) @23°C	90 minutes	
Working strength @23°C	2 hours	
Full cure @23°C	48 hours	

Typical Performance of Cured Adhesive

Shear strength* (ISO4587)	PA6: >10 N/mm² **SF (>1450 psi) PA6,6: >6 N/mm² **SF (>870 psi)* PA6 30% GF: 14-18 N/mm² (2030-2610 psi) Mild Steel to PA6,6: >10 N/mm² **SF (>1450 psi)* Aluminium to PA6,6: >10 N/mm² **SF (1450 psi)
Tensile strength (ASTM D638)	20 N/mm² (2900 psi)
Elongation at break (ASTM D638)	11%

^{*}Strength results will vary depending on the level of surface preparation

^{**}SF denotes substrate failure.

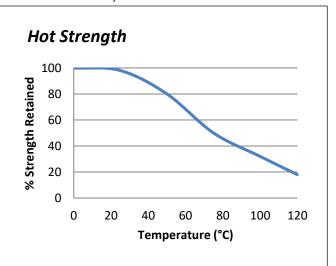

Fully cured lap shear specimens conditioned to pull temperature for 30 minutes before testing at temperature.

TA4660 can withstand higher temperatures for brief periods (such as for paint baking and wave soldering processes) providing the joint is not unduly stressed. The minimum temperature the cured adhesive can be exposed to is -40°C depending on the materials being bonded.

Page 1/2

The information given and the recommendations made herein are based on our research and are believed to be accurate but no guarantee of their accuracy is made. In every case we urge and recommend that purchasers before using any product in full-scale production make their own tests to determine to their own satisfaction whether the product is of acceptable quality and is suitable for their particular purpose under their own operating conditions. THE PRODUCTS DISCLOSED HEREIN ARE SOLD WITHOUT ANY WARRANTY AS TO MERCHANTABILITY OR FITNESS FOR A PARTICULAR PURPOSE OR ANY OTHER WARRANTY, EXPRESS OR IMPLIED.

No representative of ours has any authority to waive or change the foregoing provisions but, subject to such provisions, our engineers are available to assist purchasers in adapting our products to their needs and to the circumstances prevailing in their business. Nothing contained herein shall be construed to imply the non-existence of any relevant patents or to constitute a permission, inducement or recommendation to practice any invention covered by any patent, without authority from the owner of this patent. We also expect purchasers to use our products in accordance with the guiding principles of the Chemical Manufacturers Association's Responsible Care® program

Additional Information

This product is not recommended for use in contact with strong oxidizing materials. This product may affect some thermoplastics and users must check compatibility of the product with such substrates.

Information regarding the safe handling of this material may be obtained from the safety data sheet (SDS). Users are reminded that all materials, whether innocuous or not, should be handled in accordance with the principles of good industrial hygiene.

This Technical Datasheet (TDS) offers guideline information and does not constitute a specification.

Storage & Handling

Storage Temperature	5 to 25°C (41 to 77°F)

Surface Preparation

Surfaces should be clean, dry and grease-free before applying the adhesive. Surfaces may have traces of mold release agent present - wipe with isopropanol (IPA) solvent and allow to fully evaporate before bonding. If bonding to metal: some metals such as aluminium, copper and its alloys will benefit from light abrasion with emery cloth (or similar) to remove the oxide layer.

Directions for Use

- 1) Surfaces must be clean, dry and grease-free prior to bonding.
- 2) Apply a thin bead of adhesive pre-mixed through a static mixer nozzle.
- 3) Assemble components and clamp.
- 4) Maintain pressure until handling strength is achieved. The time required will vary according to the joint design and surfaces being bonded.
- 5) Allow 48 hours for adhesive to fully cure.

NB: Adhesive outside of a closed joint (i.e. excess material) will cure more slowly and may feel soft due to air contact. Adhesive inside the joint will cure solid.

Video Links

Surface preparation:

https://youtu.be/8CMOMP7hXjU

Structural acrylic directions for use: https://youtu.be/YVeKBCVVhYo





www.permabond.com

• UK: 0800 975 9800

• General Enquiries: +44 (0)1962 711661

• US: 732-868-1372

• Asia: +86 21 5773 4913

info.europe@permabond.com info.americas@permabond.com info.asia@permabond.com

The information given and the recommendations made herein are based on our research and are believed to be accurate but no guarantee of their accuracy is made. In every case we urge and recommend that purchasers before using any product in full-scale production make their own tests to determine to their own satisfaction whether the product is of acceptable quality and is suitable for their particular purpose under their own operating conditions. THE PRODUCTS DISCLOSED HEREIN ARE SOLD WITHOUT ANY WARRANTY AS TO MERCHANTABILITY OR FITNESS FOR A PARTICULAR PURPOSE OR ANY OTHER WARRANTY, EXPRESS OR IMPLIED.

No representative of ours has any authority to waive or change the foregoing provisions but, subject to such provisions, our engineers are available to assist purchasers in adapting our products to their needs and to the circumstances prevailing in their business. Nothing contained herein shall be construed to imply the non-existence of any relevant patents or to constitute a permission, inducement or recommendation to practice any invention covered by any patent, without authority from the owner of this patent. We also expect purchasers to use our products in accordance with the guiding principles of the Chemical Manufacturers Association's Responsible Care® program Permabond TA4660